

**TRUST  
THE  
ORIGINAL**

# **BNC Connectors**


**Cable to Connector &  
Connector to Cable Guide**



**NEUTRIK®**

Content	Page
<b>Cable to Connector Guide</b> .....	<b>4</b>
Argosy Image .....	4
Belden .....	4
CAE .....	4
Canare .....	5
Canford .....	5
Clark .....	5
Commscope .....	5
Cordial .....	5
Draka Multimedia Cable .....	6
Direct Cable .....	6
Kabeltronic .....	6
KLOTZ .....	6
Nexans .....	7
Percon .....	7
Proel .....	7
RG .....	7
Sommer .....	7
Suhner .....	8
Tasker .....	8
Tesca .....	8
Van Damme .....	9
Others .....	9
<b>Connector to Cable Guide</b> .....	<b>10</b>
rearTWIST HD & UHD .....	10
rearTWIST Tiny .....	10
Cable Jack Tiny & Panel Version .....	11

## BNC Connectors

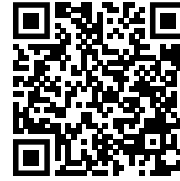

## rearTWIST UHD Connector



## rearTWIST HD



## HD BNC Cable Jacks Panel Version



## ACCESSORIES

### Colour Coded Accessories and Seals

### Assembly Tools



Example



Example



	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm	Stripping Tool			
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

### ■ Argosy Image

Argosy Image 360	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Argosy Image 720	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Argosy Image 1000	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07	1.6	7.36	●	-	-	-

### ■ Belden

Belden 1277R, 1278R, 1279R			NBTC75BNN5				1.6	4.53	●	-	-	●
Belden 1406B, 1407B, 1417B			NBTC75BVV5				1.6	5.00	●	-	-	●
Belden 1426A, 1505A (ANH), 4505R	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Belden 1505F	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-	
Belden 1506A		NBNC75BIJ9					1.6	5.41	●	-	-	-
Belden 1520A, 1521A, 1522A, 179DT			NBTC75BFI4	NBTB75CFI4			1.6	4.06	●	-	-	●
Belden 1694A (ANH, DNH)	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Belden 1694F		NBNC75BRU11					1.6	7.36	●	-	-	-
Belden 1695A	NBNC75BQP11X	NBNC75BQP11			1.07	1.6	6.47	●	-	-	-	
Belden 1794A		NBNC75BZV14					1.6	8.23	●	-	-	-
Belden 1855A	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-	
Belden 1855EFN	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 1865A			NBTC75BXX6				1.6	5.00	●	-	-	●
Belden 1855ENH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 4505P		NBNC75BIJ9					1.6	5.41	●	-	-	-
Belden 4505R	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Belden 4694P	NBNC75BQP11X	NBNC75BQP11			1.07	1.6	6.47	●	-	-	-	
Belden 4694R	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Belden 4855P	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-	
Belden 4855R	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	●	
Belden 7731A (ANH)		NBNC75BVZ17					1.8	10.00	-	-	●	-
Belden 8218			NBTC75BXX5				1.6	5.00	●	-	-	●
Belden 8241	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
Belden 8241F	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Belden 8281		NBNC75BXY9					1.6	8.23	●	-	-	-
Belden 8281F		NBNC75BY9					1.6	8.23	●	-	-	-
Belden 9221			NBTC75BLI4				1.6	4.06	●	-	-	●
Belden 70078CH HDTV			NBTC75BNN5	NBTB75CINN5			1.6	4.53	●	-	-	●
Belden 70080, 70080NH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Belden 70081, 70081NH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
Belden 70082, 70082CH & 70082NH	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
	NBNC75BTUP11X				1.07		7.06	●	-	-	-	

### ■ CAE

CAE MC75			NBTC75BLI5	NBTB75CLI5			1.6	4.06	●	-	-	●
CAE MC75.39			NBTC75BVX6				1.6	5.00	●	-	-	●
CAE KX6A	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-	
CAE VCB75		NBNC75BNP9					1.6	6.47	●	-	-	-
CAE VCB 100		NBNC75BXU13					1.6	7.36	●	-	-	-
CAE HD1250FLEX		NBNC75BXU13					1.6	7.01	●	-	-	-
CAE HD10460LSZH		NBNC75BTS11					1.6	7.01	●	-	-	-
CAE HD0628LSZH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
CAE HD08370LSZH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
CAE HD16720LSZH		NBNC75BVZ17					1.8	10.00	-	-	●	-



	rearTWIST	rearTWIST	rearTWIST	Cable Jack & Panel	Pin Crimp		Hex Crimp	Stripping				
	UHD	HD	HD Tiny		in mm	in mm		Tool				
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI	

## ■ Canare

Canare L-2.5CHWS	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Canare L-3CFB, L-3C2VS		NBNC75BHK7					1.6	5.41	●	-	-
Canare L-3.3CUHD	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Canare L-4CFB	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-
Canare L-4.5CHD, L-4.5CHWS	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Canare L-5CFB		NBNC75BYY11				1.6	8.23	●	-	-	-
Canare L-5.5 CUHD	NBNC75BZV14X					1.6	8.23	-	●	-	-
Canare LV-61S	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Canare LV-77S		NBNC75BYY9				1.6	8.23	●	-	-	-
Canare V(3-5)-3C		NBNC75BGG7				1.6	5.00	●	-	-	-
Canare V(3-5)-4CFB		NBNC75BJJ9				1.6	5.41	●	-	-	-
Canare V(3-5)-5C		NBNC75BRS9				1.6	7.01	●	-	-	-
Canare V(3-5)-5CFB		NBNC75BWS11				1.6	7.01	●	-	-	-
Canare L-1.5C2VS			NBTC75BLI4			1.6	4.06	●	-	-	●
Canare L-3CFW	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Canare L-5CFW		NBNC75BYY11				1.6	8.23	●	-	-	-

## ■ Canford

Canford SDV, SDV-X, SDM	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Canford SDV-F, SDV-XF		NBNC75BUU11				1.6	7.36	●	-	-	-
Canford SDV-F-HD		NBNC75BWU13				1.6	7.36	●	-	-	-
Canford SDV-HD		NBLC75BVZ17				1.8	10.00	-	-	●	-
Canford SDV-I-X-LFH	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Canford SDV-L, SDV-F	NBNC75BUU11X	NBNC75BUU11				1.6	7.01	●	-	-	-
Canford SDV-M		NBTB75CNN5				1.6	4.53	●	-	-	●
Canford VCS (BBC PSF1/3)		NBNC75BLS7				1.6	7.01	●	-	-	-

## ■ Clark

Clark CD7559-0, CD7559F-0	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Clark CD7523-7	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	●
Clark CD7506-0	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Clark CD7506F-0		NBNC75BRU11				1.6	7.36	●	-	-	-

## ■ Commscope

Commscope 2065V		NBNC75BIJ9				1.6	5.41	●	-	-	-
Commscope 2279V		NBNC75BQP11				1.6	6.47	●	-	-	-
Commscope 5563	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Commscope 5565	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-
Commscope 5765	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Commscope 7536 (03-05)			NBTC75BXX6			1.6	5.00	●	-	-	●
Commscope 7538	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-

## ■ Cordial

Cordial CVI 3-7	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	4.53	●	-	-	-
Cordial CVI 06-28	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Cordial CVI 06-28HD, CVI 06-28HD-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Cordial CVI (CVM) 06-37	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Cordial CVI 08-37 HD-FRNC		NBNC75BNP9				1.6	6.47	●	-	-	-
Cordial CVI 10-48 HD	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-

	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm	Stripping Tool				
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI	
Cordial CVI 10-48 HD-FRNC		NBNC75BWS11					1.6	7.01	●	-	-	-
Cordial CVM 08-32 HD-FLEX		NBNC75BIJ9					1.6	5.41	●	-	-	-
Cordial CVM 08-37 UHD-FLEX	NBNC75BJP9X	NBNC75BJP9			1.07		1.6	6.47	●	-	-	-
Cordial CVM 12-50 HD-FLEX		NBNC75BWU13					1.6	7.36	●	-	-	-
Cordial CVM 12-50 UHD-FLEX		NBNC75BWU13					1.6	7.36	●	-	-	-

### ■ Draka Multimedia Cable

0.31 / 1.45 AF, 753-1304(2), 755-1302			NBTC75BFI4	NBTB75CFI4			1.6	4.06	●	-	-	●
0.41 / 1.9 AF, 753-1104, 755-1103, 755-1101			NBTC75BNN5	NBTB75CNN5			1.6	4.53	●	-	-	●
0.51 / 2.3 Dz, 757-1001, VADN 7243			NBTC75BVX6				1.6	5.00	●	-	-	●
0.6 / 2.8 AF, 0.6 L / 2.8 AF	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
HD Pro 0.6/2.8 AF	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
0.6 / 3.7, 0.6L / 3.7	NBNC75BLP7X	NBNC75BLP7			1.07		1.6	6.47	●	-	-	-
0.6 / 3.7 Dz		NBNC75BLS7					1.6	7.01	●	-	-	-
0.8 / 3.7 AF, 755-801(803, 804)	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07		1.6	6.47	●	-	-	-
Highflex 08L/3.7D, HD Pro 0.8/3.7 AF	NBNC75BLP9X	NBNC75BLP9			1.07		1.6	6.47	●	-	-	-
0.8 / 4.9 Dz		NBNC75BXY9					1.6	8.23	●	-	-	-
1.0 / 4.8 AF, 755-901/5	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07		1.6	7.36	●	-	-	-
1.2L / 4.8Dz, 1.2L / 4.95AF		NBNC75BWU13					1.6	7.36	●	-	-	-
1.4 / 6.6 AF		NBLC75BSX14					1.75	9.73	-	●	-	-
1.6 / 7.3AF		NBLC75BVZ17					1.8	10.00	-	-	●	-
Ultra HD PRO50 UHD	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-

### ■ Direct Cable

Direct Cable 301-299	NBNC75BLP9X	NBNC75BLP9			1.07		1.6	6.47	●	-	-	-
Direct Cable 301-330	NBNC75BTU11X	NBNC75BTU11			1.07		1.6	7.36	●	-	-	-
Direct Cable 301-340		NBNC75BRU11					1.6	7.60	●	-	-	-
Direct Cable 301-351	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
Direct Cable 301-361	NBNC75BTU11X	NBNC75BTU11			1.07		1.6	7.36	●	-	-	-
Direct Cable 360-036	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
Direct Cable 360-031	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-

### ■ Kabeltronik

Kabeltronik HFV 1.0/4.8 AF-FRNC		NBNC75BRU11					1.6	7.36	●	-	-	-
Kabeltronik HFV 0.6/2.8 AF-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
Kabeltronik MVP 5x 0.6/2.8 AF-FRNC	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-

### ■ KLOTZ

KLOTZ V06/28, V062SH, VMXx75Y	NBNC75BFG7X	NBNC75BFG7			1.07		1.6	5.00	●	-	-	-
KLOTZ V06/37	NBNC75BLP7X	NBNC75BLP7			1.07		1.6	6.47	●	-	-	-
KLOTZ V08/37H, VD083SH	NBNC75BLP9X	NBNC75BLP9			1.07		1.6	6.47	●	-	-	-
KLOTZ V10/48, V10/48H	NBNC75BUU11X	NBNC75BUU11		NBNB75GUU11	1.07		1.6	7.36	●	-	-	-
KLOTZ V16/72		NBLC75BVZ17					1.8	10.00	-	-	●	-
KLOTZ VD083LP 0.8L/3.7DZ	NBNC75BJP9X	NBNC75BJP9			1.07		1.6	6.47	●	-	-	-
KLOTZ VD125LPS		NBNC75BWU13					1.6	7.36	●	-	-	-
KLOTZ VD167SH-E		NBLC75BVZ17					1.8	10.00	-	-	●	-

	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm	Hex Crimp in mm	Stripping Tool				
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

### ■ Nexans

Nexans HF 75 0.6/2.9 02YS(ST)CH	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Nexans HF 75 1.6/7.2 02Y(ST)C(ST)H		NBNC75BVZ17					1.8	10.00	-	-	●
Nexans HF 75 0.6/3.7 2YCY	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-

### ■ Percon

Percon VK2			NBTC75BNN5			1.6	4.53	●	-	-	●
Percon VK5	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Percon VK6	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Percon VK66 ENH	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-
Percon VK7	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Percon VK77	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Percon VK770F		NBNC75BWU13				1.6	7.36	●	-	-	-
Percon VK8		NBLC75BSX14				1.75	9.73	-	●	-	-
Percon VK9		NBLC75BVZ17				1.8	10.0	-	-	●	-
Percon VK95	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-

### ■ Proel

Proel HPC 805	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
Proel HPC 810	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Proel HPC 820		NBNC75BFH6				1.6	5.00	●	-	-	-

### ■ RG

RG11		NBLC75BVZ17				1.8	10.00	-	-	●	-
RG59B/U	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
RG179B/U			NBTC75BLI4			1.6	4.06	●	-	-	●

### ■ SOMMER

SOMMER 600-0041C			NBTC75NBS4			1.6	4.53	●	-	-	-
SOMMER 600-0051 (M/L/S)	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0054 (M/L/S)	NBNC75BLP7X	NBNC75BLP7			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0101M	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0104M	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0131		NBLC75BSX14				1.75	9.73	-	●	-	-
SOMMER 600-0144	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
SOMMER 600-162(F), Vctor 0.8/3.7	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
SOMMER 600-0174		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-0174FC		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-0214		NBNC75BWU13				1.6	7.36	●	-	-	-
SOMMER 600-025* -03 (05)			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-0701			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-020* -03 (05)			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
SOMMER 600-0234		NBLC75BVZ17				1.8	10.00	-	-	●	-
SOMMER 600-0234FC		NBLC75BVZ17				1.8	10.00	-	-	●	-
SOMMER 600-0451	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-
SOMMER 600-0621-05	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0751			NBTC75BVX6			1.6	5.00	●	-	-	●
SOMMER 600-0791	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0851	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
SOMMER 600-0851-05	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-

	rearTWIST	rearTWIST	rearTWIST	Cable Jack & Panel	Pin Crimp		Hex Crimp		Stripping			
	UHD	HD	HD Tiny		in mm	in mm	UHD	HD	CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI
SOMMER 600-1031		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-1451	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
-SOMMER 600-2001		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2031		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2101	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
SOMMER 600-2231	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-	
SOMMER 600-2781		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2791		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-2811-01		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 600-3202		NBNC75BWU13				1.6	7.36	●	-	-	-	
SOMMER 605-0761	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
<b>■ Suhner</b>												
Suhner G02233			NBTC75BFI4	NBTB75CFI4		1.6	4.06	●	-	-	●	
Suhner G04233D		NBNC75BLS7				1.6	7.01	●	-	-	-	
Suhner S02223			NBTC75BLI4			1.6	4.06	●	-	-	●	
Suhner S04233, S04263	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-	
Suhner S05133-07	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Suhner S05163-02	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
<b>■ Tasker</b>												
Tasker RGB75			NBTC75BFI4			1.6	4.06	●	-	-	-	
Tasker RG59BU		NBNC75BLP7				1.6	6.47	●	-	-	-	
Tasker RG11AU		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tasker TSK1077LSZH		NBNC75BFG7				1.6	5.00	●	-	-	-	
Tasker TSK1078LSZH	NBNC75BLP9X	NBNC75BLP9				1.6	6.47	●	-	-	-	
Tasker TSK1079LSZH	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-	
Tasker TSK1080LSZH		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tasker T42 PVC		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tasker T42 PUR		NBNC75BWU13				1.6	7.36	●	-	-	-	
<b>■ Tesca</b>												
Tesca Bachelor		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tesca Bachelor PUR		NBNC75BZV14				1.6	8.23	-	●	-	-	
Tesca Bengal			NBTC75BNS4			1.6	4.53	●	-	-	●	
Tesca DUBLO V		NBNC75BWU13				1.6	7.36	●	-	-	-	
Tesca Fabio 12G		NBNC75BUU11				1.6	7.36	●	-	-	-	
Tesca KXV6		NBNC75BLP7				1.6	6.47	●	-	-	-	
Tesca Supra	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-	
Tesca Massimo		NBLC75BSX14				1.75	9.73	-	●	-	-	
Tesca Sphere		NBLC75BVZ17				1.8	10.00	-	-	●	-	
Tesca Presto		NBNC75BJP9				1.6	6.47	●	-	-	-	
Tesca Prima		NBNC75BTS11				1.6	7.01	●	-	-	-	
Tesca Linea		NBNC75BNP9				1.6	6.47	●	-	-	-	
Tesca Vostok		NBNC75BWS12				1.6	7.01	●	-	-	-	
Tesca Dublo		NBNC75BWS12				1.6	7.01	●	-	-	-	





	rearTWIST UHD	rearTWIST HD	rearTWIST HD Tiny	Cable Jack & Panel	Pin Crimp in mm		Hex Crimp in mm	Stripping Tool			
					UHD	HD		CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

**■ Van Damme**

Van Damme 268-175-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Van Damme 268-275-000	NBNC75BJP9X	NBNC75BJP9			1.07	1.6	6.47	●	-	-	-
Van Damme 268-306-000	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Van Damme 268-408-000			NBTC75BF4			1.6	6.47	●	-	-	●
Van Damme 268-475-000	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Van Damme 268-675-000	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Van Damme 278-475-000		NBLC75BVZ17				1.8	10.00	-	-	●	-
Van Damme 278-175-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Van Damme 278-975-000	NBNC75BLP9X	NBNC75BLP9			1.07	1.6	6.47	●	-	-	-
Van Damme 278-775-000			NBTC75BSS5			1.6	4.53	●	-	-	●
Van Damme 278-075-000	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Van Damme 278-075-006	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Van Damme 278-375-000	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-

**■ Others**

AT&T 735			NBTC75BSS5			1.6	4.53	●	-	-	●
COMM-TEC RGBHV			NBTC75BSS5			1.6	4.53	●	-	-	●
BBC PSF 1/3*		NBNC75BLS7				1.6	7.01	●	-	-	-
COVID CVD 1300-1500			NBTC75BLI5	NBTB75CLI5		1.6	4.06	●	-	-	●
Eupen 705 CRT 5V-HS		NBNC75BTS11				1.6	7.36	●	-	-	-
Extron BNC-5HR			NBTC75BNN5	NBTB75CNN5		1.6	4.53	●	-	-	●
Extron BNC-5RC	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
GEPCO VDM230	NBNC75BDD6X	NBNC75BDD6			1.07	1.6	4.53	●	-	-	-
GEPCO VPM2000	NBNC75BLP9X	NBNC75BLP9		NBNB75GLP9	1.07	1.6	6.47	●	-	-	-
GEPCO VSD2001	NBNC75BTU11X	NBNC75BTU11			1.07	1.6	7.36	●	-	-	-
Helix 734		NBNC75BNP9				1.6	6.47	●	-	-	-
Helix 735			NBTC75BSS5			1.6	4.53	●	-	-	●
Hirschmann KOKA 712Cu		NBNC75BTS9				1.6	6.47	●	-	-	-
Kansai 3C-5S		NBNC75BFH6				1.6	5.00	●	-	-	-
Kelsey SD-1	NBNC75BFG7X	NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Kelsey SD-1-LL		NBNC75BWS11				1.6	7.01	●	-	-	-
KROSCHU (341 270, 341 280)			NBTC75BLI4		1.6	4.06	●	-	-	●	-
Pro Plex RG6 TMB	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Pro Plex RG11		NBLC75BVZ17				1.8	10.00	-	-	●	-
Pro Plex RG59	NBNC75BUU11X	NBNC75BUU11			1.07	1.6	7.36	●	-	-	-
Quadronics CABPGHD70MW-500		NBNC75BFG7			1.07	1.6	5.00	●	-	-	-
Wisi MK 99A		NBNC75BWS12				1.6	6.47	●	-	-	-
ZNK CM14B			NBTC75BF4	NBTB75CF4		1.6	4.06	●	-	-	●

\* Registered trademark of BBC

	Inner Conductor	Insulator	Cable O.D. mm	Pin crimp mm (square)	Hex Crimp mm	Stripping Tool			
						CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

## rearTWIST HD & UHD

NBLC75BVZ17	< 1.7	< 8.0	< 10.4	1.80 (Hex crimp)	10.00	-	-	●	-
NBLC75BSX14	< 1.4	< 6.6	< 9.5	1.75 (Hex crimp)	9.73	-	●	-	-
NBNC75BDD6	< 0.6	< 2.8	< 4.3	1.6	4.53	●	-	-	-
NBNC75BDD6X	< 0.6	< 2.8	< 4.3	1.07	4.53	●	-	-	-
NBNC75BFG7	< 0.7	< 3.1	< 4.7	1.6	5.00	●	-	-	-
NBNC75BFG7X	< 0.7	< 3.1	< 4.7	1.07	5.00	●	-	-	-
NBNC75BFH6	< 0.6	< 3.1	< 4.9	1.6	5.00	●	-	-	-
NBNC75BGG7	< 0.7	< 3.2	< 4.7	1.6	5.00	●	-	-	-
NBNC75BHK7	< 0.7	< 3.3	< 5.6	1.6 (or 1.75 Hex)	5.41	●	-	-	-
NBNC75BIJ9	< 0.9	< 3.6	< 5.3	1.6	5.41	●	-	-	-
NBNC75BIJ9	< 0.9	< 3.8	< 5.3	1.6	5.41	●	-	-	-
NBNC75BJP9	< 0.9	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BJP9X	< 0.9	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLP7	< 0.7	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BLP7X	< 0.7	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLP9	< 0.9	< 3.8	< 6.3	1.6	6.47	●	-	-	-
NBNC75BLP9X	< 0.9	< 3.8	< 6.3	1.07	6.47	●	-	-	-
NBNC75BLS7	< 0.7	< 3.8	< 6.9	1.6	7.01	●	-	-	-
NBNC75BNP9	< 0.9	< 4.1	< 6.3	1.6	6.47	●	-	-	-
NBNC75BQP11	< 1.1	< 4.5	< 6.3	1.6	6.47	●	-	-	-
NBNC75BQP11X	< 1.1	< 4.5	< 6.3	1.07	6.47	●	-	-	-
NBNC75BRS9	< 0.9	< 4.8	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTS9	< 0.9	< 4.7	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTS11	< 1.1	< 4.7	< 6.9	1.6	7.01	●	-	-	-
NBNC75BTU11	< 1.1	< 4.7	< 7.3	1.6	7.36	●	-	-	-
NBNC75BTU11X	< 1.1	< 4.7	< 7.3	1.07	7.36	●	-	-	-
NBNC75BTUP11X	< 1.1	< 4.7	< 7.3	1.07	7.06	●	-	-	-
NBNC75BTU13	< 1.4	< 4.7	< 7.3	1.6	7.36	●	-	-	-
NBNC75BUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	●	-	-	-
NBNC75BUU11X	< 1.1	< 4.9	< 7.3	1.07	7.36	●	-	-	-
NBNC75BRU11	< 1.1	< 4.8	< 7.3	1.6	7.36	●	-	-	-
NBNC75BWS11	< 1.1	< 5.1	< 6.9	1.6	7.01	●	-	-	-
NBNC75BWS12	< 1.2	< 5.1	< 6.9	1.6	7.01	●	-	-	-
NBNC75BWU13	< 1.4	< 5.1	< 7.3	1.6	7.36	●	-	-	-
NBNC75BXU13	< 1.4	< 5.3	< 7.3	1.6	7.36	●	-	-	-
NBNC75BXY9	< 0.9	< 5.3	< 8.0	1.6	8.23	●	-	-	-
NBNC75BYY9	< 0.9	< 5.2	< 8.0	1.6	8.23	●	-	-	-
NBNC75BYY11	< 1.1	< 5.2	< 8.0	1.6	8.23	●	-	-	-
NBNC75BZV14	< 1.4	< 5.2	< 8.2	1.6 (or 1.75 Hex)	8.23	●	-	-	-
NBNC75BZV14X	< 1.4	< 5.2	< 8.2	1.6 (or 1.75 Hex)	8.23	●	-	-	-
NBNC75BXU13X	< 1.4	< 5.3	< 7.3	1.6	7.36	●	-	-	-




	Inner Conductor	Insulator	Cable O.D. mm	Pin crimp mm (square)	Hex Crimp mm	Stripping Tool			
						CS-BNC-RT	CS-BNC-LCS	CS-BNC-LCV	+ CS-BNC-TCI

## rearTWIST TINY

NBTC75BFI4	< 0.4	< 1.6	< 2.9	1.6	4.06	•	-	-	•
NBTC75BLI4	< 0.4	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBTC75BLI5	< 0.5	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBTC75BNN5	< 0.5	< 2.0	< 3.1	1.6	4.53	•	-	-	•
NBTC75BNS4	< 0.4	< 2.0	< 3.5	1.6	4.53	•	-	-	•
NBTC75BSS5	< 0.5	< 2.3	< 3.4	1.6	4.53	•	-	-	•
NBTC75BVV5	< 0.5	< 2.5	< 3.8	1.6	5.00	•	-	-	•
NBTC75BVX6	< 0.6	< 2.5	< 4.0	1.6	5.00	•	-	-	•
NBTC75BXX5	< 0.5	< 2.6	< 4.0	1.6	5.00	•	-	-	•
NBTC75BXX6	< 0.6	< 2.6	< 4.0	1.6	5.00	•	-	-	•

## CABLE JACKS (TINY & PANEL VERSION)

NBTB75CFI4	< 0.4	< 1.6	< 2.9	1.6	4.06	•	-	-	•
NBTB75CNN5	< 0.5	< 2.0	< 3.1	1.6	4.53	•	-	-	•
NBTB75CLI5	< 0.5	< 1.8	< 2.9	1.6	4.06	•	-	-	•
NBNB75GLP9	< 0.9	< 3.8	< 6.3	1.6	6.47	•	-	-	•
NBNB75GUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	•	-	-	•
NBNB75ILP9	< 0.9	< 3.8	< 6.3	1.6	6.47	•	-	-	•
NBNB75IUU11	< 1.1	< 4.9	< 7.3	1.6	7.36	•	-	-	•

# NEUTRIK®

The premium brand of the Neutrik Group

## LIECHTENSTEIN (HEADQUARTERS)

Neutrik AG, Im alten Riet 143, 9494 Schaan

T +423 237 24 24, F +423 232 53 93, neutrik@neutrikgroup.com



[www.neutrik.com](http://www.neutrik.com)